

# AC Current Probe

## Model MN379

### User Manual

---

#### DESCRIPTION

The MN379 (Catalog #2153.01) is the latest in compact AC current probes. Designed to meet the most stringent demands in industry and electrical contracting, it also meets the latest safety and performance standards. The probe has a measurement range up to 120Arms, a range and resolution capable of displaying 10mV of output per amp of measured current, a voltmeter accuracy of 0.5% or better to take full advantage of the accuracy of the probe and an input impedance of  $\geq 1\text{M}\Omega$ .

#### WARNING

The safety warnings are provided to ensure the safety of personnel and proper operation of the instrument. Read the instruction completely.

- Use caution on any circuit: potentially high voltages and currents may be present and may pose a shock hazard.
- Do not use the probe if damaged. Always connect the current probe to the measuring device before it is connected around the conductor
- Do not use on non-insulated conductor with a potential to ground greater than 600V CAT III pollution 2. Use extreme caution when clamping around bare conductors or bus bars.
- Before each use, inspect the probe; look for cracks in housing or output cable insulation.
- Do not use clamp in wet environment or in locations that hazardous gases exist.
- Do not use the probe anywhere beyond the tactile barrier.

#### INTERNATIONAL ELECTRICAL SYMBOLS



This symbol signifies that the current probe is protected by double or reinforced insulation. Use only factory specified replacement parts when servicing the instrument.



This symbol signifies CAUTION! and requests that the user refer to the user manual before using the instrument.



This is a type A current sensor. This symbol signifies that application around and removal from HAZARDOUS LIVE conductors is permitted.

#### DEFINITION OF MEASUREMENT CATEGORIES

**CAT I:** For measurements on circuits not directly connected to the AC supply wall outlet such as protected secondaries, signal level, and limited energy circuits.


**CAT II:** For measurements performed on circuits directly connected to the electrical distribution system. Examples are measurements on household appliances or portable tools.

**CAT III:** For measurements performed in the building installation at the distribution level such as on hardwired equipment in fixed installation and circuit breakers.

**CAT IV:** For measurements performed at the primary electrical supply (<1000V) such as on primary overcurrent protection devices, ripple control units, or meters.

#### RECEIVING YOUR SHIPMENT

Upon receiving your shipment, make sure that the contents are consistent with the packing list. Notify your distributor of any missing items. If the equipment appears to be damaged, file a claim immediately with the carrier and notify your distributor at once, giving a detailed description of any damage

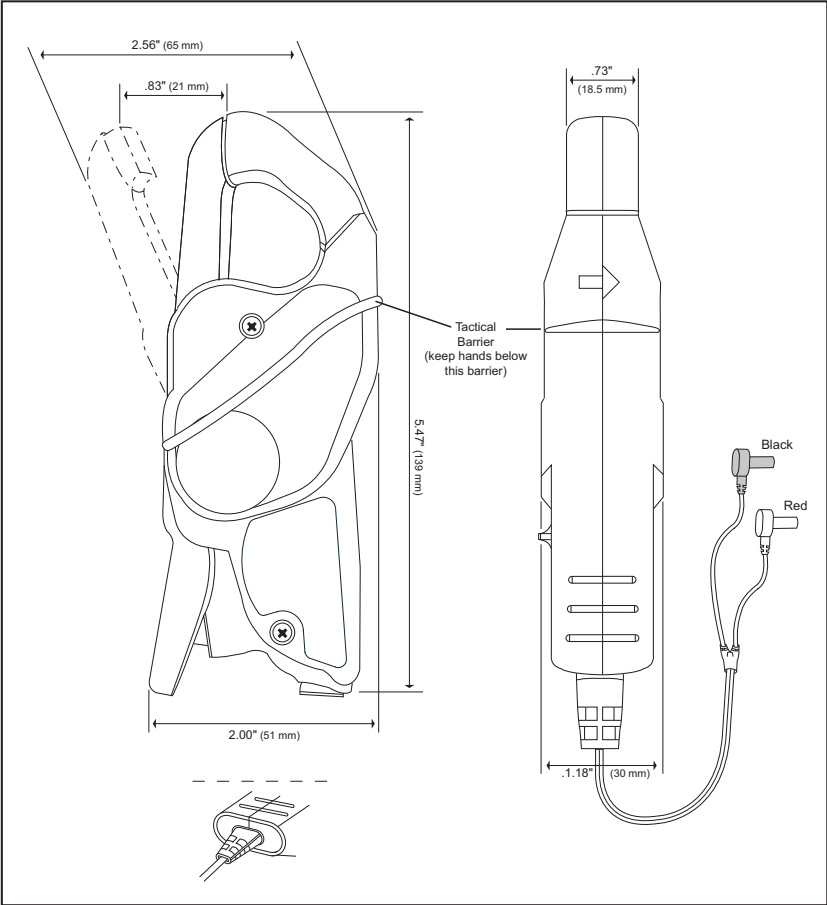

### **ELECTRICAL SPECIFICATIONS**

**Nominal Range:** 5A, 100A

**Measurement Range:** 5A: 0.005 to 6A  
100A: 0.1 to 120A

**Transformation Ratio:** Voltage output

**Output Signal:** 5A: 200mV/A  
100A: 10mV/A

**Accuracy and Phase Shift\*:**

*5A Range - Accuracy*

I <sub>p</sub>	0.005A	0.05A	0.5A	5A
V <sub>s</sub> %	1.5 % +0.02mV	1.5%	1%	1%
Phase	6.5 °	5 °	4.5 °	4 °

*100A Range - Accuracy*

I <sub>p</sub>	0.1A	1A	10A	100A
V <sub>s</sub> %	1% +0.02mV	1%	1%	1%
Phase	3.2 °	2.2 °	2.2 °	2.2 °

\*Reference conditions: 18°C to 28°C, 20 to 75% RH, external magnetic field <40 A/m, 48 to 65Hz sine wave, distortion factor less than 1%, no DC component, no external current carrying conductor, test sample centered. Load impedance > 1MΩ.

**Frequency Range:** 40 to 10kHz

**Limit Operating Conditions:**

200A MAX to 1kHz; Derating above 1kHz:  
200A x (1°F), F in kHz

**Working Voltage:** 600Vrms

**Common Mode Voltage:**

600Vrms

**Influence of Adjacent Conductor:**

< 15mA/A at 50Hz

**Influence of DC on AC signal:**

5A Range: DC Current < 1A, < 3%

100A Range: DC Current < 10A, < 10%

**Influence of Conductor Position in Jaw:**

0.5% of mV output @ 50/60Hz

**Influence of Frequency:**

5A Range:

40Hz to 1kHz: <0.7% of mV output

1kHz to 3kHz: <2%% of mV output

150A Range:

40Hz to 1kHz: <0.7% of mV output

1kHz to 3kHz: <0.7% of mV output

**Influence of Temperature:**

≤ 200 ppm/°K, or 0.2% of mV output per 10°K

**Influence of Humidity (10 to 90% RH):**

≤ 0.2% of mV output per 10°K @ 18° to 28°C

**MECHANICAL SPECIFICATIONS****Operating Temperature:**

14° to 131°F (-10° to +55°C)

**Storage Temperature:**

-40° to 158°F (-40° to +70°C)

**Operating Relative Humidity:**

10° to 35°C 85% RH

(without roll-off above 35°C)

**Maximum Cable Diameter:**

One Ø 0.78" (20mm), bus bar 20 x 5 mm

**Case Protection:**

IP 40 (IEC 529)

**Drop Test:**

Test per IEC 68-2-32:

1.0 m drop on 38mm of Oak on concrete

Test per IEC 68-2-27

**Vibration:**

Test per IEC 68-2-6

**Dimensions:**

5.47 x 2.00 x 1.18"

(139 x 51 x 30mm)

**Weight:**

180g (6.5oz)

**Polycarbonate Material:**

Jaws: Polycarbonate with 10% fiberglass

charge, Red UL 94 V0

Case: Polycarbonate 920A Gray

**Opening Operations - Life: > 50,000****Output:**

Double/reinforced insulated 5 ft (1.5m) lead with safety 4mm banana plug

**SAFETY SPECIFICATIONS****Electrical:**

Double insulation or reinforced insulation between the primary or secondary and the outer case of the handle conforms to IEC 1010-2-32.

**Common Mode Voltage:**

600V Category III, Pollution Degree 2

**Electromagnetic Compatibility:**

Emissivity: EN61326-1 Class B

Electrostatic discharge IEC 1000-4-2

Radiated field IEC 1000-4-3

Fast transients IEC 1000-4-4

Magnetic field at 50/60Hz IEC 1000-4-8

**ORDERING INFORMATION****AC Current Probe MN379 ..... Cat #2153.01**

*Includes a user manual*

**Accessories:**

Banana plug adapter

(to non-recessed plug) ..... Cat #1017.45

Adapter - Banana (Female) -

BNC (Male) (XM-BB) ..... Cat #2118.46

## OPERATION

Please make sure that you have already read and fully understand the WARNING section on page 1.

### Making Measurements with the AC Current Probe Model MN379

- Connect the black lead of the current probe to “common” and the red lead to the AC voltage input on your DMM or other voltage-measuring instrument. The AC current probe has an output of 200mV/A and 10mV/A. This means that with the probe in the 10mV/A position, for 100A AC in a conductor around which the probe is clamped, 1V AC will come out of the probe leads to your DMM or instrument. Select the range which corresponds to the measured current. If the current magnitude is unknown, start with the probe in the 10mV/A position and if the current is < 5 amps the probe can be switched to the 200mV/A position for the higher resolution. Clamp the probe around the conductor. With the probe in the 10mV/A position take the reading on the meter and multiply it by 100 to obtain the measured current (e.g, 160mV reading =  $160 \times 100 = 16,000\text{mA}$  or 16A).
- The 5A range is design to measure on 5A current transformer. The output is 1V rms for 5A measured. Enter a scale factor in the meter if possible for direct reading.
- For best accuracy, avoid if possible, the proximity of other conductors which may create noise.

### Tips for Making Precise Measurements

- When using a current probe with a meter, it is important to select the range that provides the best resolution. Failure to do this may result in measurement errors.
- Make sure that probe jaw mating surfaces are free of dust and contamination. Contaminants cause air gaps between the jaws, increasing the phase shift between primary and secondary. It is very critical for power measurement.

## MAINTENANCE:

### Warning

- For maintenance use only original factory replacement parts.
- To avoid electrical shock, do not attempt to perform any servicing unless you are qualified to do so.
- To avoid electrical shock and/or damage to the instrument, do not get water or other foreign agents into the probe

### Cleaning

To ensure optimum performance, it is important to keep the probe jaw mating surfaces clean at all times. Failure to do so may result in error in readings. To clean the probe jaws, use very fine sand paper (fine 600) to avoid scratching the jaw, then gently clean with a soft oiled cloth.

## REPAIR AND CALIBRATION

You must contact our Service Center for a Customer Service Authorization number (CSA#). This will ensure that when your instrument arrives, it will be tracked and processed promptly. Please write the CSA# on the outside of the shipping container. If the instrument is returned for calibration, we need to know if you want a standard calibration, or a calibration traceable to N.I.S.T. (includes calibration certificate plus recorded calibration data).

Chauvin Arnoux®, Inc. d.b.a. AEMC® Instruments  
15 Faraday Drive • Dover, NH 03820 USA

Tel: (800) 945-2362 (Ext. 360)  
(603) 749-6434 (Ext. 360)

Fax: (603) 742-2346 or (603) 749-6309  
repair@aemc.com

(Or contact your authorized distributor)

Costs for repair, standard calibration, and calibration traceable to N.I.S.T. are available.

NOTE: All customers must obtain a CSA# before returning any instrument.

## TECHNICAL AND SALES ASSISTANCE

If you are experiencing any technical problems, or require any assistance with the proper use or application of this instrument, please call our technical hotline:

(800) 343-1391 • (508) 698-2115 • Fax (508) 698-2118

Chauvin Arnoux®, Inc. d.b.a. AEMC® Instruments  
techsupport@aemc.com • www.aemc.com